
ITEM NO.	PART NUMBER	DESCRIPTION	G907P /QTY.	K
1	00343	LOCK WASHER	4	
2	04259	INT. RETAINING RING	1	
3	04258	EXT. RETAINING RING	2	
4	04264	FLAT WASHER	1	
5	09000	RUBBER IMPELLER	1	
6	10195	CAM SCREW 10-32NFT	1	
7	10926	SEAL SEAT	1	(E)(G)
8	12211	BALL BEARING	2	
9	18576	KEY, WOODRUFF	1	
10	18035	MECHANICAL SEAL	1	(E)
11	18573	CAP SCREW	2	
12	18574	LOCK WASHER	2	
13	18663	CAM	1	
14	19964	O-RING	1	(H)
15	21857	FLAT WASHER	1	
16	21859	PULLEY	1	
17	21862	HOUSING	1	
18	21916	SCREW, SOCKET HD CAP	4	
19	21974	SPACER	1	
20	24124	SHAFT	1	F
21	24125	COVER PLATE	1	H
22	24126	LOCK WASHER	1	(H)
23	24127	SERRATED FLANGE NUT	1	

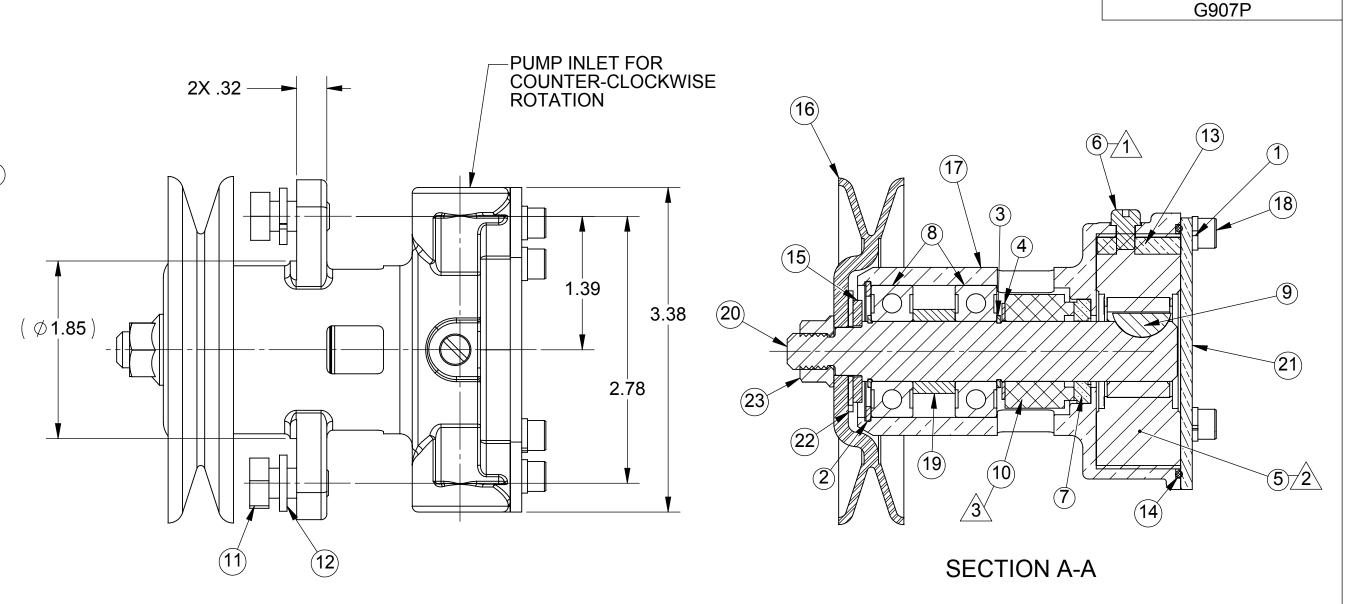

PART NUMBER

REV.

SURFACE

N/A MAX

TLG DATE: 11/07/94

DATE:

REPLACES PART NO.:

DECIMAL .X

DWG BY:

CHECKED BY:

APPROVED BY:

PART NUMBER

DECIMAL .XX: DECIMAL .XXX:

TOLERANCES (+ OR -)

ALL DIMS. IN INCHES, DIMS. IN [] ARE IN MM UNLESS OTHERWISE SPECIFIED

THIS DRAWING IS THE PROPERTY OF HYPRO,

AND WITHOUT WRITTEN AUTHORIZATION, MUST NOT BE COPIED OR COMMUNICATED

G907P

DRAWING BASED ON ASME Y14.5M-1994

DO NOT SCALE PRINT

THIRD ANGLE

SCALE

1:1

SHEET NUMBER


1 OF 1

PART VOLUME


12.699 in³

SIZE

PROJECTION

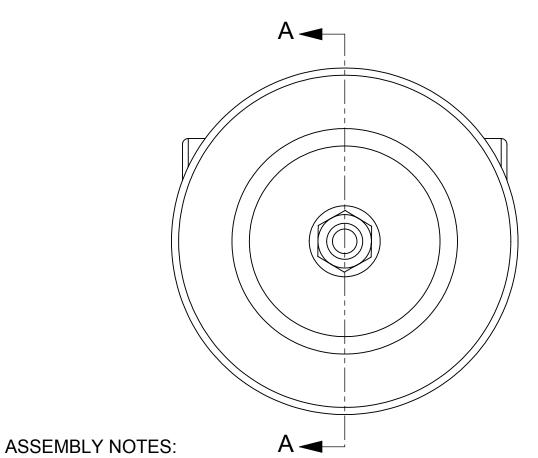

- 1. APPLY PERMATEX FORM-A GASKET NO. 1 (HARD SETTING) SEALENT, OR EQUIV. TO THREADS AND BASE OF HEAD TO CAM SCREW PRIOR TO INSTALLATION.
- 2. USE COOLANT TO AID IN INSTALLATION OF RUBBER IMPELLER.
- 3. USE PAC-EASE, OR EQUIV, WHEN INSTALLING MECHANICAL SEAL.
- 4. STAMP "G907P" AND DATE CODE ON COVER PLATE.
- 5. MANUFACTURING: HAND TIGHTEN LOCK NUT ONLY. INSTALLATION: TORQUE TO 30FT-LBS
- 6. MANUFACTURING: INSTALL BOLT TO APPROXIMATELY 4 FULL TURNS. INSTALLATION: TORQUE TO 30FT-LBS
- 6. STATIC TEST PUMP TO 20 PSI.

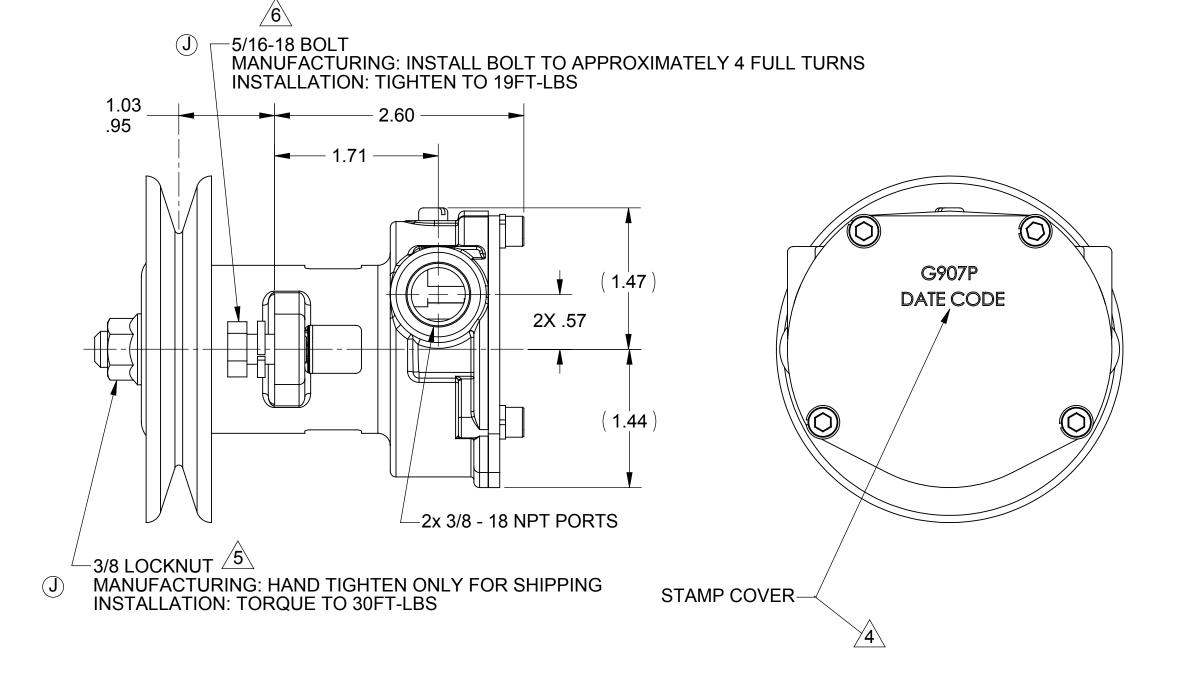

JJH

TW

РΒ

DV

RJE

RJE

DV

DV

CHKD

8/4/2008

1-30-2008

3-9-2007

8-7-2006

4-27-06

08-04-05

9-27-2002

DATE

10-28-03 MATERIAL

375 Fifth Avenue NW New Brighton, MN 55112 (651) 766-6300

N/A

N/A

SEE BOM

IMPELLER PUMP

URFACE TREATMENT

HEAT TREATMENT

PART DESCRIPTION

7003

6656

6174

5817

5632

4907

3754

1995

ECN

G

UPDATED BOM - CHANGED QTY OF 21857

WAS G907P-02

INSTALLATION TORQUE ADDED

KEY 18576 WAS 13777

UPDATED BOM & DRAWING

ADDED BALL BEARING 12211, REMOVED 23448

COVER 24125 WAS 19965

UPDATED BOM & DRAWING

REVISION DESCRIPTION

REVISIONS